



01252330804

info@wallsanddoors.co.uk

www.wallsanddoor.co.uk

JOB #	835
DATE	8th October 2025
CLIENT	Ellendune Community Centre
SITE ADDRESS	Barrett Way, Wroughton, Swindon, SN4 9LW
CALL BACK REQUIRED?	Yes
TRAVEL TIME	2 hours each way
TIME ON SITE	5 hours

ISSUE REPORTED	WORK CARRIED OUT
General service and movable wall repairs	Description of Works Completed Upon attendance, our engineers carried out a full inspection and repair of the movable wall system. The wall was stripped down in situ to access the internal roller housing components. During inspection, it was identified that the top roller housing bearing had insufficient fixings, which was causing instability in the operation of the wall panels. The faulty roller housing was secured with additional fixings, ensuring the section is now safe and operating correctly. Functionality tests were carried out following the repair, and the panel is now in safe working order. □ Findings Further inspection revealed that several other panels are affected by the same issue, where the roller housings have inadequate fixings. This is considered a design flaw, which can compromise the structural integrity and stability of the movable wall system if not addressed. □ Recommendations We strongly recommend that the same repair procedure—installing additional fixings to secure the roller housings—is carried out on the remaining affected panels as soon as possible.

	Completing these additional repairs will: • Prevent further structural degradation of the wall system • Ensure smooth and safe operation of all panels • Maintain compliance with safety and operational standards ☐ Status ☐ Current panel: Repaired and operational ☐ Remaining panels: Require further repair work
ADDITIONAL NOTES	MATERIALS USED
	Fixings roller housing sleeve

CUSTOMER NAME	CUSTOMER SIGNATURE
	

BEFORE PHOTOS





01252330804
info@wallsanddoors.co.uk
www.wallsanddoor.co.uk

AFTER PHOTOS